



# Preliminary Information

## PIP5710 Charge Air Cooler Tube Disconnected at Throttle Body DTC P0172 P0299 P0101 P0506 P1101

Proactive

Product Investigation Review Required

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Equinox	2020	All	All	1.5 LYX	All
Chevrolet	Malibu	2020	All	All	1.5 LFV	All
GMC	Terrain	2020	All	All	1.5 LYX	All
Holden	Equinox	2020	All	All	1.5 LYX	All

<b>Involved Region or Country:</b>	<b>North America</b>
<b>Condition:</b>	<b>Reduced engine power with one or more of the following DTC's P0172 P0299 P0101 P0506 P1101.</b>
<b>Cause:</b>	<b>Charge air cooler tube may have become disconnected from throttle body.</b>

**Correction:**

**Confirm the charge air cooler tube has become disconnected from the throttle body.**

**If the charge air cooler tube has become disconnected from the throttle body. The tube can be reattached by pushing down on the connection ensuring the retainer snaps into position. Clear trouble codes and validate repairs.**

**If the charge air cooler tube is not disconnected complete published SI diagnostics for DTC's that have set.**

Warranty Information

**For vehicles repaired under the Emission coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.**

Labor Operation:	Description	Labor Time:
4087338	Reattach charge air cooler tube and throttle body and clear codes	0.3 Hr.

Version History

Version	1
Modified	02/11/2020 - Created on.



GENERAL MOTORS

© 2020 General Motors. All Rights Reserved.